
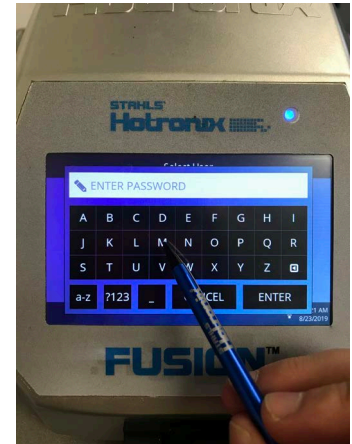



## Set the Press temperature to 350 Degrees

You will need to be in the manager setting to access the calibration menu. Select the person icon, choose manager, and enter the password, which is M.

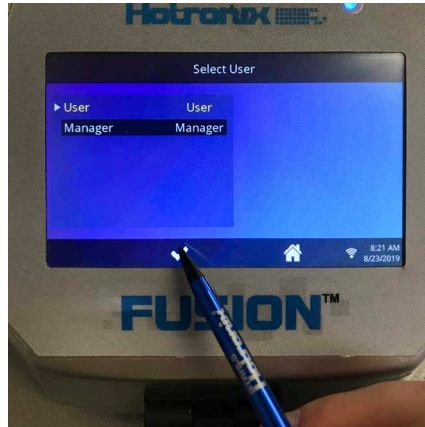

Tap the Home icon, then select the gear icon.

Once in settings, tap the wrench icon.

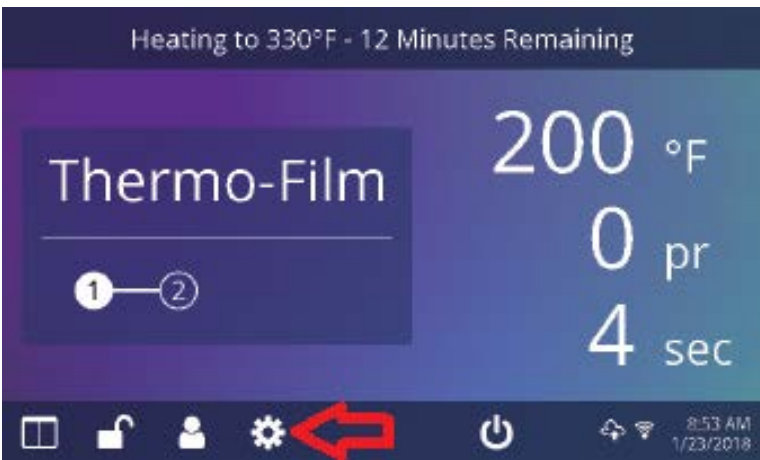

1. Choose Platen Pressure Calibration




2. It may say Calibration Successful, but you can disregard and just tap Calibrate again. It will adjust to display a voltage on the screen in the 2.50v range approx.



3. When you lock your press handle down the voltage number will change. You will need to manually adjust the pressure and lock the press down until it is set to around 2.70v when closed. Then tap set Min Point.



After setting the Min Point, lift the handle back up and increase the pressure knob clockwise again to set the max point. You want 3.0v to display when the press is closed. Then tap set Max Point.

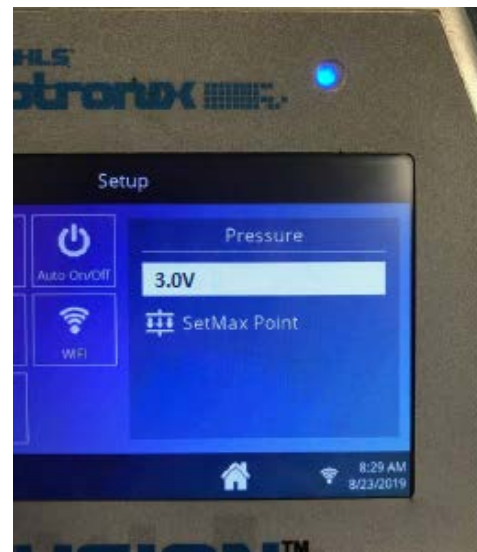

The screen will prompt you that calibration is complete. You can return to the main menu and start using your press.